



# Stacking washer DIN ISO 10069-2

## Thrust washer

2441.3.

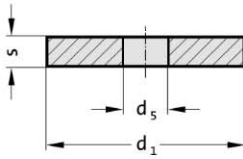

Mounting example

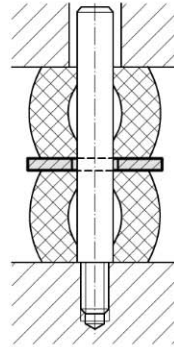

2441.3. Stacking washer DIN ISO 10069-2

Material:  
Brass


Spring-Ø	16	20	25	32	40	50	63	80	100	125
d <sub>1</sub>	20	25	30	40	50	60	80	100	120	150
d <sub>s</sub>	6.5	8.5	10.5	13.5	13.5	16.5	16.5	20.5	20.5	26
s	4	4	5	5	5	6	6	8	8	8




Ordering Code (example):

Stacking washer DIN ISO 10069-2	=2441.3.
Spring diameter Spring-Ø	50 mm = 050
Order No	=2441.3.050

244.4.

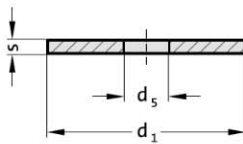

Mounting example

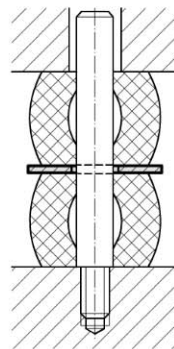

244.4. Thrust washer

Material:  
St 37

Spring-Ø	16	20	25	32	40	50	63	80	100	125
d <sub>1</sub>	20	26	32	40	50	60	80	100	120	150
d <sub>s</sub>	6.5	8.5	10.5	13.5	13.5	16.5	16.5	20.5	20.5	26
s	1	1.5	2	2.5	2.5	3	3	4	4	5



Ordering Code (example):

Thrust washer	=244.4.
Spring diameter Spring-Ø	50 mm = 050
Order No	=244.4.050